

TQCN DOC# FTR-80N129671	Affiliate TMS	Dept. QA-Vehicle and	Source FTS	Location TMS-GST	Ref 43351-1	Date 10/24/2007
Problem Area PPO/DIO	Primary Model Tacoma	Model Year 2006	Production Date 01-Aug-2006	Odometer 7176 mi	VIN (confirm 17 characters): 5TEKU72N06Z [REDACTED]	
Condition Title FLOOR MAT ALL WEATHER - REF# 58525						

Do not type in YELLOW shaded fields - Input data from Web page or RDM:

Repair Date 09-JAN-2007	Optional Ref.	Optional Approval
-----------------------------------	---------------	-------------------

Condition Description

Left front all weather floor mat interferes with the proper operation of the accelerator pedal when the mat is not properly installed.

Diagnostic Steps:

1. Road test vehicle and verified the interference between the accelerator pedal and the all weather floor mat.
2. Next removed the all weather floor mat and road tested the vehicle and found that the operation of the accelerator pedal was normal.

Probable Cause

Improper installation of all- weather floor mat.

Part # 1: PT9083505D02	Part # 2:	Part # 3:	Parts Disposition: No part available	Parts Shipping Destination: 3500
---------------------------	-----------	-----------	---	-------------------------------------

Repair Process

Cut flashing off of the rear portion of the mat and reinstalled into the vehicle with the retainer clips installed and the interference with the accelerator pedal was no longer evident.

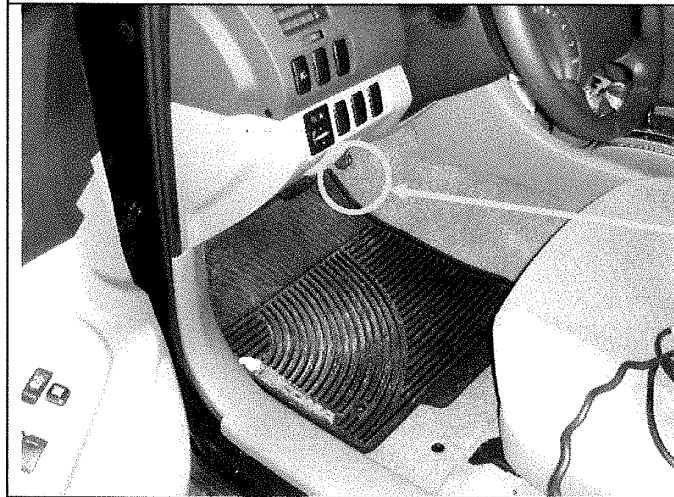


Photo showing location of the accelerator pedal interference with floor mat.