

FIELD TECHNICAL REPORT



TQCN DOC# FTR-3LE608771		Affiliate TMS	Dept. QA-Powertrain	Source FTS	Location TMS-LWA	Ref 38834-1	Date 3/29/2007
Problem Area Base Vehicle	Primary Model IS 350	Model Year 2006	Production Date 26-Jun-2006	Odometer 9215 mi	VIN (confirm 17 characters): JTHBE262562 [REDACTED]		
Condition Title Accelerator pedal did not return							

Do not type in YELLOW shaded fields - Input data from Web page or RDM:

Repair Date 22-MAR-2007	Optional Ref.	Optional Approval
----------------------------	---------------	-------------------

Condition Description

7:00am, outside temp about 45 deg.
Customer states she was driving vehicle approximately 70mph, when releasing accelerator pedal, the pedal did not return to full release position.

Diagnostic Steps:

<Check by Technician>
8:00am, outside temp about 55 deg. (Same day customer experienced above stated condition)
Technician attempted to duplicate condition - when he pushed accelerator pedal by hand, accelerator pedal stuck at approximately 1/2 of pedal travel. He then attempted to release pedal by hand and pedal returned to its full released position. Attempted to duplicate condition again – pedal now operates as designed.
<Go & See result>
7:00am, outside temp about 46 deg. (Next day)
We checked for condition again - could not duplicate the described condition. However, we felt abnormal response when pushing the accelerator pedal by hand. After multiple press and release actions, the abnormal response feel, seemed to diminish.


Probable Cause

Unknown at this time.

Part # 1: 7811053040	Part # 2:	Part # 3:	Parts Disposition: Have part / will ship	Parts Shipping Destination: CQEC
-------------------------	-----------	-----------	---	-------------------------------------

Repair Process


We replaced accelerator pedal Assy. (CQE person hand carried this part for shipment to Japan)

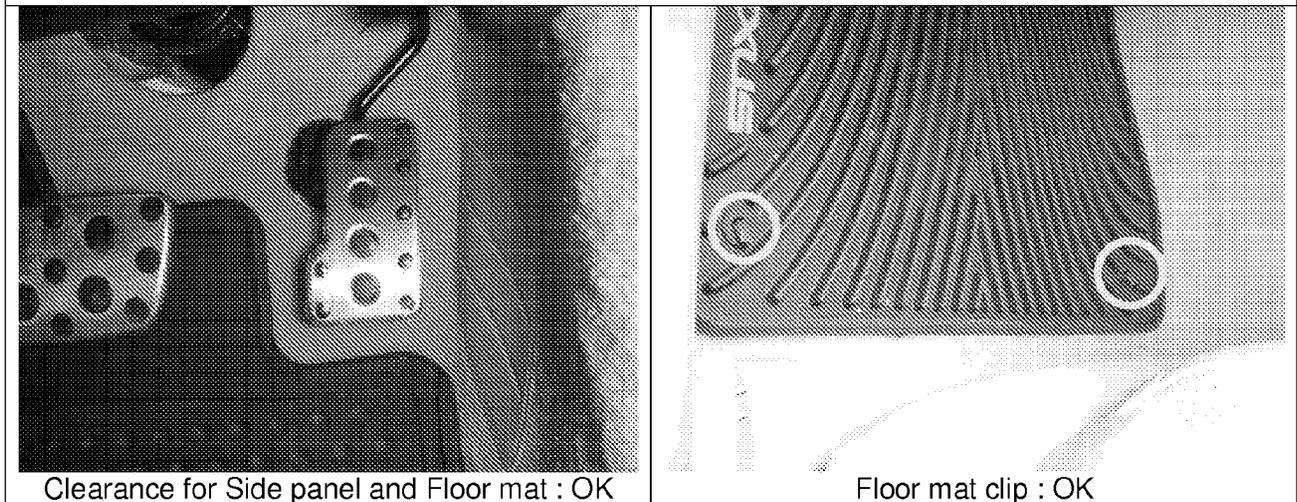

FIELD TECHNICAL REPORT



TQC#N DOC# FTR-3LE608771		Affiliate TMS	Dept. QA-Powertrain	Source FTS	Location TMS-LWA	Ref 38834-1	Date 3/29/2007
Problem Area Base Vehicle	Primary Model IS 350	Model Year 2006	Production Date 26-Jun-2006	Odometer 9215 mi	VIN (confirm 17 characters): JTHBE262562 [REDACTED]		
Condition Title Accelerator pedal did not return							

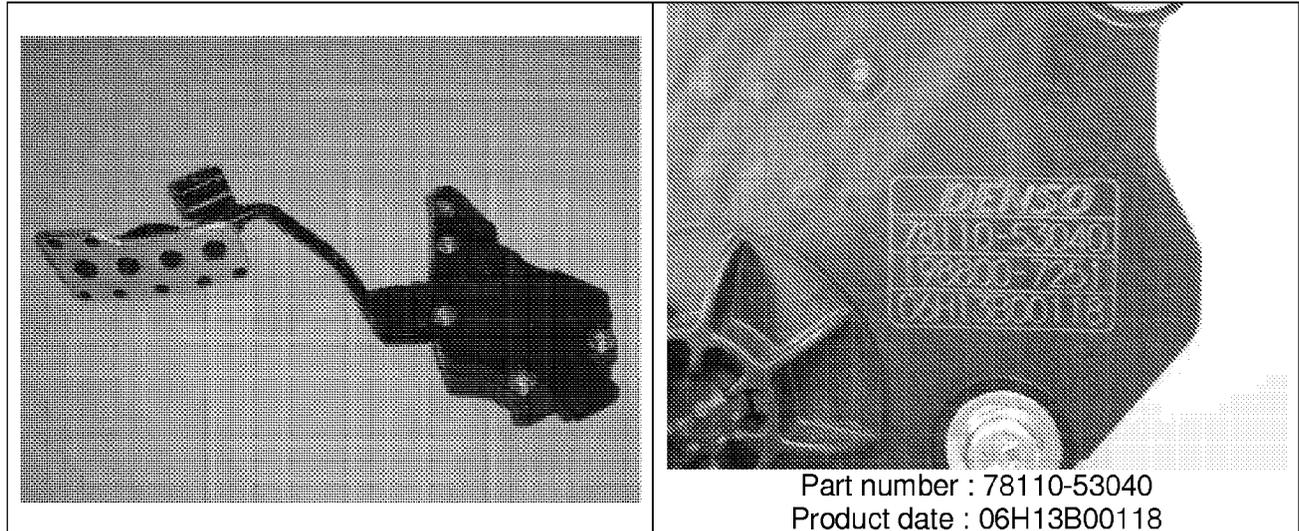

Part number : 78110-53040
Product date : 06H13B00118

Attachment 1: PRCS

Attachment 1: Parts Recovery Control Sheet

Do not type in SHADED fields. If the **Final Destination** field below is "scrap", properly dispose of the part.

Orig Tracking

VIN

Doc No.



Final Destination: CQEC	SETR#:	CQE Eng:	N/A
Importer: (Applies to TMC Shipments Only) Mr. N. Okumura, Chief Expert Quality Div. Warranty Parts Room TOYOTA MOTOR CORPORATION 1 Toyota, Toyota-city, Aichi, 471-8571 Japan	Deliver to: Attn: Tel:	住所 : 宛先 : Tel:	
T-STAR			
Note: If this FTR contains more than one VIN, create a table in the report containing VIN, production date, and odometer			FOR CUSTOMS USE: Used Parts Value
1	Part # 1: 7811053040 Comments:	Part Description SENSOR ASSY, ACCELERATOR PEDAL	Qty. 1 Used Part Value \$ 61.00