

QABody	TA090610044	2T2GK31U27C	██████	2-Mar-09	3/2/2009 7:32	2-Mar-09	3/2/2009 7:32	46,870
QABody	TA090610144	JTJGK31UX89	██████	2-Mar-09	3/2/2009 9:52	2-Mar-09	3/2/2009 9:52	25,640
QABody	TA090630220	JTHGL46F485	██████	4-Mar-09	3/4/2009 10:54	4-Mar-09	3/4/2009 10:54	10,302
QABody	TA090640296	5TBRU34146S	██████	5-Mar-09	3/5/2009 13:53	5-Mar-09	3/5/2009 13:53	25,231
QABody	TA090640312	JTEBT17R968	██████	5-Mar-09	3/5/2009 15:00	5-Mar-09	3/5/2009 15:00	23,619
QAChassis	TA090610367	1NXBU40E79Z	██████	2-Mar-09	3/2/2009 15:59	2-Mar-09	3/2/2009 15:59	8,017
QAChassis	TA090620118	JTJHT00W154	██████	3-Mar-09	3/3/2009 8:56	3-Mar-09	3/3/2009 8:56	37,053
QAChassis	TA090620142	JTEEW44AX82	██████	3-Mar-09	3/3/2009 9:29	3-Mar-09	3/3/2009 9:29	12,653
QAChassis	TA090630237	JTHBL46F285	██████	4-Mar-09	3/4/2009 11:17	4-Mar-09	3/4/2009 11:17	14,918
QAChassis	TA090630301	JTJHW31UX60	██████	4-Mar-09	3/4/2009 12:52	4-Mar-09	3/4/2009 12:52	31,672
QAChassis	TA090630303	5TDZA22C36S	██████	4-Mar-09	3/4/2009 12:56	4-Mar-09	3/4/2009 12:56	10,276
QAChassis	TA090640288	JTHBK262582	██████	5-Mar-09	3/5/2009 13:35	5-Mar-09	3/5/2009 13:35	19,446
QAChassis	TA090640300	5TELU42N57Z	██████	5-Mar-09	3/5/2009 14:19	5-Mar-09	3/5/2009 14:19	16,465
QAChassis	TA090640309	JTEBT17R968	██████	5-Mar-09	3/5/2009 14:51	5-Mar-09	3/5/2009 14:51	23,619
QAChassis	TA090660019	JTDKB20U387	██████	7-Mar-09	3/7/2009 10:43	7-Mar-09	3/7/2009 10:43	7,885
QAChassis	TA090660037	JTLKE50E881	██████	7-Mar-09	3/7/2009 15:23	7-Mar-09	3/7/2009 15:23	17,218
QAElectrical	TA090610215	2T2GK31U58C	██████	2-Mar-09	3/2/2009 11:31	2-Mar-09	3/2/2009 11:31	15,096
QAElectrical	TA090610297	1NXBR30E97Z	██████	2-Mar-09	3/2/2009 13:36	2-Mar-09	3/2/2009 13:36	12,257
QAElectrical	TA090620226	2T1BR32EX8C	██████	3-Mar-09	3/3/2009 11:41	3-Mar-09	3/3/2009 11:41	32,256
QAElectrical	TA090630228	JTDKB20U383	██████	4-Mar-09	3/4/2009 11:03	4-Mar-09	3/4/2009 11:03	30,766
QAElectrical	TA090630249	JTDKB20U640	██████	4-Mar-09	3/4/2009 11:38	4-Mar-09	3/4/2009 11:38	73,692
QAElectrical	TA090630355	5TBET34176S	██████	4-Mar-09	3/4/2009 14:22	4-Mar-09	3/4/2009 14:22	42,321
QAElectrical	TA090640074	JTHBJ46G472	██████	5-Mar-09	3/5/2009 7:50	5-Mar-09	3/5/2009 7:50	17,196
QAElectrical	TA090640119	4T1BK46K79U	██████	5-Mar-09	3/5/2009 8:43	5-Mar-09	3/5/2009 8:43	13
QAElectrical	TA090640247	4T1BK36BX8U	██████	5-Mar-09	3/5/2009 12:20	5-Mar-09	3/5/2009 12:20	13,157

	RX350	2007	63904	SOU	SOU	4	INITIATE		3/2/2009 0:00
	RX350	2008	60905	SOU	SOU	3	INITIATE		3/2/2009 0:00
	LS460	2008	60905	SOU	SOU	3	INITIATE		3/4/2009 0:00
	Tundra	2006	4282	LOS	LOS	9	INITIATE		3/5/2009 0:00
	4Runner	2006	31162	NYR	NYR	1	INITIATE		3/5/2009 0:00
							INITIATE		
	Corolla	2009	4282	LOS	LOS	9	D		3/2/2009 0:00
							INITIATE		
	LX470	2005	60915	SOU	SOU	3	D		3/3/2009 0:00
	Highlander HV	2008	4842	LOS	LOS	2	INITIATE		3/3/2009 0:00
	LS460	2008	61002	SOU	SOU	6	INITIATE		3/4/2009 0:00
							INITIATE		
C1253,U0121	RX400H	2006	64202	SOU	SOU	2	D		3/4/2009 0:00
C1223,C1243,U0123,U0124,U0126	Sienna	2006	29031	NYR	NYR	5	INITIATE		3/4/2009 0:00
	IS250	2008	60448	WES	WES	3	INITIATE		3/5/2009 0:00
	Tacoma	2007	43022	DEN	DEN	4	INITIATE		3/5/2009 0:00
C1223,C1236	4Runner	2006	31162	NYR	NYR	1	INITIATE		3/5/2009 0:00
							INITIATE		
	Prius	2008	4256	SFR	SFR	2	D		3/7/2009 0:00
U0073	xB	2008	4135	LOS	LOS	7	INITIATE		3/7/2009 0:00
	RX350	2008	64204	SOU	SOU	1	INITIATE		3/2/2009 0:00
	Corolla	2007	36057	PTL	PTL	5	INITIATE		3/2/2009 0:00
							INITIATE		
	Corolla	2008	37177	CAT	CAT	8	D		3/2/2009 0:00
							INITIATE		
B1200,B1207,B1271,P0A0F,P3193	Prius	2008	48030	CHI	CHI	7	D		3/4/2009 0:00
							INITIATE		
	Prius	2004	4109	LOS	LOS	5	D		3/3/2009 0:00
B1773	Tundra	2006	30032	DEN	DEN	5	INITIATE		3/3/2009 0:00
	ES350	2007	63132	EAS	EAS	3	INITIATE		3/5/2009 0:00
							INITIATE		
B2287,B2289,B2785	Camry	2009	45077	CAT	CAT	10	D		3/4/2009 0:00
							INITIATE		
	Avalon	2008	37112	CAT	CAT	6	D		3/5/2009 0:00

Vehicle Interior	Seat	Seat Components	Noise-squeak/rattles
Vehicle Interior	Interior Panels/Trim	Trim	Gap/Poor Fit/Loose/Tolerance
Vehicle Exterior	Door/Hatch	Window Mechanism	Noise-Abnormal
Vehicle Exterior	Window/Glass	Side Window Glass	Noise-squeak/rattles
Vehicle Interior	Seat	Seat Track	Abnormal Operation
Suspension	Alignment/Handling Diagnoses	Unknown	Pulls left/right
Suspension	Front Suspension	Unknown	Unspecified
Suspension	Tire/Wheel	Tire	Noise-Abnormal
Brake	Brake Control/Dynamic Control System	ABS	Noise-Abnormal
Brake	Brake Control/Dynamic Control System	ABS	Condition-Not-Listed
Brake	Brake Control/Dynamic Control System	Warning Light - ABS	MIL/Warning Light ON
Brake	Brake (front)	Unknown	Noise-squeak/rattles
Brake	Brake System	Brake Pedal	Comfort/feel
Brake	Brake Control/Dynamic Control System	ABS	Abnormal Operation
Vehicle Exterior	Frame/Unibody	Unknown	Condition-Not-Listed
Steering	Power Assist Systems	Unknown	MIL/Warning Light ON
Power Source/Network	Battery/Charging	Battery	Corrosion
Vehicle Interior	Theft Deterrent/Keyless Entry	Security Remote	Inoperative
Audio/Visual/Telematics	Audio/Video	Radio Receiver	Inoperative
Vehicle Interior	Meter/Gauge/Display	Electronic Information Display	Abnormal Operation
Audio/Visual/Telematics	Navigation/Multi Info Display	Nav System/Display/Components	Abnormal Operation
Vehicle Interior	Supplemental Restraint Systems	Warning Light - SRS	MIL/Warning Light ON
Power Source/Network	Networking	Unknown	Abnormal Operation
Engine/Hybrid System	Starting	Unknown	Starting-No start
Audio/Visual/Telematics	Navigation/Multi Info Display	Nav System/Display/Components	Design/Less Than Expectation

rear seats are rubbing together causing noise. tried to reposition seats and applied leather conditioner to seats noise will go away but comes back.
rattle noise coming from right front window area
grinding sound from motor/regulator mesh gear

customer states noise in l/f seat while driving.

customer states veh pulls left intermitt. road tested , no pull at this time , checked alignment ok. tire pressure ok checked frame bolts, struts , all tight
customer states that when vehicle is parked over night the next morning front suspension is lower than rear no codes were found and the vehicle has been
in the shop more than one day but nothing happened problem intermittent vehicle was released to customer

clicking sound from front brakes.

client states check engine light flashing, vehicle will not move. vehicle went into ready on techs first attempt. no abnormalities detected, only above
codes found.

customer states vsc lights, trac off and check engine light come on at times.

second time customer complaining brake noise when backing up intermittently. unable to duplicate concern both times at this time

brake pedal feels abnormally stiff brakes work fine no codes etc

customer states abs light comes on

water leak rf floor board area. 1/2 in water +. performed water test unable to confirm water leak. inspected firewall wet. removed low and upper dash for
further inspection. windshield area appears dry.

not a hard code. can't duplicate please see attachments

wire harness badly corroded due to leaking Johnson battery

vehicle has no sound from unit. unit will tune radio stations and play cds but no volume at all. power source and grounds are good. speaker wire
continuity good. replaced with same model unit and symptoms are identical. called for another radio but needs case first.

customer states dash lights go out at times. customer also states power button does not work at times. can not duplicate either complaint. however, above codes
were stored in history

display reads "external system not connected" only when trying to go to a nav function. all other display functions are normal including a/c. no trouble
codes no loose pins, nav unit powers up

c/s 2 front power windows lose memory every 4-6 weeks

has another issue that may be the cause. severe condensation inside car. most components behind dash are damp. just had 8+ inches of snow now no
start and lots of water inside car. can not pinpoint water source but note rust on cross brace and most metal parts up to the bottom of windshield.

when using nav controller (under radio) if you are trying to enter the calendar for example when you press enter button you go back to the caution screen
for nav. maybe 1 in 10 times it will go to calendar screen tried on a new car 2009 operated in similar manner

LEXUS
LEXUS
LEXUS
TOYOTA
TOYOTA

TOYOTA

LEXUS
TOYOTA
LEXUS

LEXUS
TOYOTA
LEXUS
TOYOTA
TOYOTA


TOYOTA
TOYOTA
LEXUS
TOYOTA

TOYOTA

TOYOTA
TOYOTA
LEXUS

TOYOTA

TOYOTA

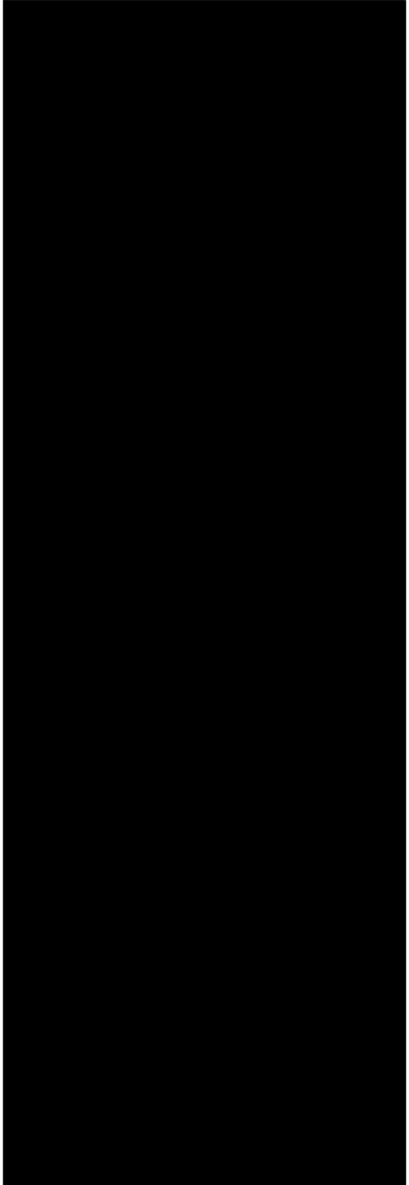

y
y
y
y
y

y

y
y
y
y
y


y
y
y
y

y

y
y
y

y

y



JIM HUDSON LEXUS,COLUMBIA
JM LEXUS
JM LEXUS
TOYOTA OF ESCONDIDO
TOYOTA OF MANHATTAN

TOYOTA OF ESCONDIDO

LEXUS OF KENDALL
MILLER TOYOTA
HENNESSY LEXUS OF ATLANTA

LEXUS OF AUSTIN
GALAXY TOYOTA
LEXUS OF STEVENS CREEK
KARL MALONE TOYOTA
TOYOTA OF MANHATTAN

HAYWARD TOYOTA
I-10 TOYOTA
SEWELL LEXUS
COOS BAY TOYOTA

KENNY ROSS TOYOTA

WILDE TOYOTA

TOYOTA OF GLENDORA
WEBB CHEVROLET-TOYOTA
LEXUS OF QUEENS

HALEY TOYOTA OF FARMVILLE

DEL TOYOTA

QABody	92607 NORMAL
QABody	178169 NORMAL
QABody	179014 NORMAL
QABody	456538 NORMAL
QABody	133141 NORMAL
QAChassis	456095 NORMAL
QAChassis	200584 NORMAL
QAChassis	996380 NORMAL
QAChassis	300341 NORMAL
QAChassis	203472 NORMAL
QAChassis	116589 NORMAL
QAChassis	22631 NORMAL
QAChassis	558522 NORMAL
QAChassis	133141 NORMAL
QAChassis	446732 NORMAL
QAChassis	221073 NORMAL
QAElectrical	1478348 NORMAL
QAElectrical	53152 NORMAL
QAElectrical	95734 NORMAL
QAElectrical	633813 NORMAL
QAElectrical	561952 NORMAL
QAElectrical	228947 NORMAL
QAElectrical	37069 NORMAL
QAElectrical	66621579 NORMAL
QAElectrical	401215 NORMAL

QAElectrical	TA090640251	JTMHY05J484	██████	5-Mar-09	3/5/2009 12:31	5-Mar-09	3/5/2009 12:31	6,677
QAElectrical	TA090640338	JTHBE262162	██████	5-Mar-09	3/5/2009 17:08	5-Mar-09	3/5/2009 17:08	28,325
QAElectrical	TA090640339	4T1BK46K67U	██████	5-Mar-09	3/5/2009 17:10	5-Mar-09	3/5/2009 17:10	31,005
QAElectrical	TA090650064	2T2GK31U49C	██████	6-Mar-09	3/6/2009 7:05	6-Mar-09	3/6/2009 7:05	3,181
QAElectrical	TA090650099	JTMHY05J685	██████	6-Mar-09	3/6/2009 8:03	6-Mar-09	3/6/2009 8:03	1,220
QAElectrical	TA090650112	JTHBH96S165	██████	6-Mar-09	3/6/2009 8:27	6-Mar-09	3/6/2009 8:27	65,988
QAElectrical	TA090650161	JTHBN36F755	██████	6-Mar-09	3/6/2009 9:38	6-Mar-09	3/6/2009 9:38	43,255
QAElectrical	TA090650224	5TDZK22C77S	██████	6-Mar-09	3/6/2009 11:37	6-Mar-09	3/6/2009 11:37	25,495
QAElectrical	TA090650263	4T1BK36B16U	██████	6-Mar-09	3/6/2009 13:05	6-Mar-09	3/6/2009 13:05	25,298
QAElectrical	TA090650309	JTDKB20U657	██████	6-Mar-09	3/6/2009 14:43	6-Mar-09	3/6/2009 14:43	76,247
QAElectrical	TA090660003	JTDKB20U873	██████	7-Mar-09	3/7/2009 6:57	7-Mar-09	3/7/2009 6:57	43,845
QAElectrical	TA090660009	JTHBJ46GX72	██████	7-Mar-09	3/7/2009 9:02	7-Mar-09	3/7/2009 9:02	74,703
QAElectrical	TA090660010	5TEJU62NX5Z	██████	7-Mar-09	3/7/2009 9:12	7-Mar-09	3/7/2009 9:12	46,651
QAElectrical	TA090660011	5TDZA23C85S	██████	7-Mar-09	3/7/2009 9:18	7-Mar-09	3/7/2009 9:18	63,342
QAElectrical	TA090660016	5TEUU42N09Z	██████	7-Mar-09	3/7/2009 10:22	7-Mar-09	3/7/2009 10:22	652
QAHybrid	TA090610251	JTDKB20U467	██████	2-Mar-09	3/2/2009 12:11	2-Mar-09	3/2/2009 12:11	102,887
QAHybrid	TA090630171	JTEEW21A460	██████	4-Mar-09	3/4/2009 9:47	4-Mar-09	3/4/2009 9:47	16,573
QAHybrid	TA090630256	4T1BB46K68U0	██████	4-Mar-09	3/4/2009 11:43	4-Mar-09	3/4/2009 11:43	27,811
QAHybrid	TA090640276	JTEEW41AX82	██████	5-Mar-09	3/5/2009 13:09	5-Mar-09	3/5/2009 13:09	6,864
QAHybrid	TA090660006	4T1BB46K19U	██████	7-Mar-09	3/7/2009 7:55	7-Mar-09	3/7/2009 7:55	11,723
QAPowertrain	TA090610001	JTJHT00W743	██████	2-Mar-09	3/2/2009 4:53	2-Mar-09	3/2/2009 4:53	43,896
QAPowertrain	TA090610043	4T3ZF13C4WU	██████	2-Mar-09	3/2/2009 7:31	2-Mar-09	3/2/2009 7:31	97,308
QAPowertrain	TA090610076	JTHBH96S465	██████	2-Mar-09	3/2/2009 8:13	2-Mar-09	3/2/2009 8:13	62,707

	Land Cruiser	2008	27015	DEN	DEN	3	INITIATE INITIATE		3/5/2009 0:00
	IS350	2006	60429	WES	WES	3	D		3/5/2009 0:00
	Camry	2007	36047	PTL	PTL	3	INITIATE		3/5/2009 0:00
	RX350	2009	60908	SOU	SOU	3	INITIATE		3/6/2009 0:00
	Land Cruiser	2008	12141	CHI	CHI	2	INITIATE		3/6/2009 0:00
B1861	GS300	2006	61903	EAS	EAS	6	INITIATE INITIATE		3/6/2009 0:00
	LS430	2005	64203	SOU	SOU	2	D		3/6/2009 0:00
	Sienna	2007	29102	NYR	NYR	5	INITIATE		3/6/2009 0:00
	Avalon	2006	29031	NYR	NYR	5	INITIATE		2/4/2009 0:00
B1200,B1271	Prius	2005	12106	CHI	CHI	5	INITIATE		3/6/2009 0:00
							INITIATE		
C2300,C2318	Prius	2007	7009	CAT	CAT	1	D		3/7/2009 0:00
B1826	ES350	2007	60906	SOU	SOU	4	INITIATE		3/7/2009 0:00
P0705	Tacoma	2005	46090	PTL	PTL	1	INITIATE		3/7/2009 0:00
B0111	Sienna	2005	4282	LOS	LOS	9	INITIATE		3/7/2009 0:00
							INITIATE		
	Tacoma	2009	29086	NYR	NYR	5	D		3/7/2009 0:00
P0A80,P3001/23,P3014,P3015	Prius	2006	41040	CIN	CIN	K	INITIATE		3/2/2009 0:00
P0A80,P3011	Highlander HV	2006	4508	LOS	LOS	2	INITIATE		3/4/2009 0:00
							INITIATE		
P0A10/263	Camry HV	2008	37177	CAT	CAT	8	D		3/3/2009 0:00
							INITIATE		
B1000,C1310,P3107	Highlander HV	2008	4143	SFR	SFR	4	D		3/5/2009 0:00
P0A80/123	Camry HV	2009	4011	LOS	LOS	1	INITIATE		3/7/2009 0:00
							INITIATE		
	LX470	2004	60905	SOU	SOU	3	D		2/25/2009 0:00
	Sienna	1998	26026	KCY	KCY	5	INITIATE		3/2/2009 0:00
C1201,P0751	GS300	2006	60449	WES	WES	3	INITIATE		3/2/2009 0:00

Power Source/Network	Battery/Charging	Unknown	Unspecified
Audio/Visual/Telematics	Garage Door Opener	Unknown	Abnormal Operation
Vehicle Interior	Supplemental Restraint Systems	Airbag (driver)	Noise-squeak/rattles
Vehicle Interior	Door Lock	Electric Motor	Noise-Abnormal
Vehicle Interior	Theft Deterrent/Keyless Entry	Transmitter Battery	Inoperative
Vehicle Interior	Supplemental Restraint Systems	Airbag (driver)	Abnormal Operation
Audio/Visual/Telematics	Audio/Video	Steering Wheel Pad Switch	Abnormal Operation
Vehicle Interior	Heating/Air Conditioning	Heating	Temperature Concern
Audio/Visual/Telematics	Audio/Video	Radio Receiver	Poor reception/static
Vehicle Interior	Meter/Gauge/Display	Electronic Information Display	Inoperative
Power Source/Network	Battery/Charging	Unknown	Inoperative
Vehicle Interior	Supplemental Restraint Systems	Airbag (passenger)	Inoperative
Drivetrain	Automatic Transmission/Transaxle	Shift Indicator	Abnormal Operation
Vehicle Interior	Supplemental Restraint Systems	Airbag (passenger)	Abnormal Operation
Audio/Visual/Telematics	Audio/Video	Unknown	Poor reception/static
Engine/Hybrid System	Hybrid/Battery Control System	Unknown	MIL/Warning Light ON
Engine/Hybrid System	Hybrid/Battery Control System	Unknown	MIL/Warning Light ON
Engine/Hybrid System	Hybrid/Battery Control System	Unknown	Abnormal Operation
Engine/Hybrid System	Hybrid/Battery Control System	Unknown	Condition-Not-Listed
Engine/Hybrid System	Hybrid/Battery Control System	Unknown	Unspecified
Engine/Hybrid System	Engine Mechanical	Unknown	Noise-Abnormal
Engine/Hybrid System	Engine Control	Ignition System	Unspecified
Drivetrain	Automatic Transmission/Transaxle	Unknown	MIL/Warning Light ON

battery going dead in 3-4 days

cust. states garage door opens when car is near without pushing homelink. verified at cust. home. disconnected homelink. garage still opened. happens when smart key is in cabin.

rattle coming from horn/airbag any possible fix besides replacing unit?

intermittent popping noise while closing rear hatch

customer states key wont work installed new battery on 2/27/09 came back dead 3/3/09 ordered smart key and programmed new fobe 3/6/09

re occuring code every 10 months or so. has had srs ecu and knee airbag replaced previously. loose connection at knee airbag, ordered harness.

steering pad volume control inop, initialized switch and had same result, have tried known good switch, also data is responding to what ever control is being operated on data list

no heat from rear system at floor vent by door

fm reception has static at times.

customer states will not start car said move vehicle to level ground no light would come on sat 3 hours car started and ran battery voltage 6.58 5.93 when codes set car was not jumped or charged battery checks good and no charging needed i know it saturday hope to call today customer up set

b1826 open in side squib pass seat

trans range sensor circuit

open in side squib r/h

radio static. i verified complaint reception is bad on all stations in all places. i compared with another 09 tacoma in stock reception was great in that vehicle. i borrowed that antenna pole and radio for comparison, reception still bad. i then borrowed antenna base reception still bad. the only thing i have'nt borrowed was the ant. cable from receiver to ant. base, for obvious reasons of tearing into a brand new dash. what should i do we don't have the cable in stock? is it a good idea to put a cable in or is there a phantom problem with these trucks?

inspected system found codes above in system, recommended hv battery, was advised to open tech case.

cust state check engine light on

battery lite and hybrid lite came on but not on when brought into shop or road tested. on prior visit hybrid ecu and dc/dc converter replaced because all other tests were ok. light was to have come on a third time checked again with known good camry all numbers ok started checking wiring and found corrosion in connector 0a1 at bottom of right kick panel cleaned out and trying to locate water leak. did not know weather to change harness or not master warning light on, vsc light on; srs light on. all relates to problem in airbag system code b1000. airbag control ecu. code can not be cleared. needs airbag ecu replace first.

loud knock noise when first started (fast idle). continuous knock when accelerating or fast idle in drive. removed oil pan, thick coating of metal on oil pan.


have had misfire #4, replaced coil, misfire #6, replaced coil, now misfire #2. i followed the tsb, is it possible to have 3 bad coils?

hard shifts and check engine light back on

TOYOTA WHITE, HANS	y		CARSON CITY TOYOTA/SCION
LEXUS NODA, RONALD	y		LEXUS OF PLEASANTON
TOYOTA YUMUL, GEORGE	y		BEAVERTON TOYOTA-SCION
LEXUS ANDRADE, VICTOR	y		SCANLON LEXUS OF FT MYERS
TOYOTA FOSTER, MICHAEL	y		ELGIN TOYOTA
LEXUS BYRNE, JEFF	y		LEXUS OF SILVER SPRING
LEXUS SOLIS, EUGENIO	y		STERLING MCCALL LEXUS
TOYOTA ELICIC, RUDOLPH	y		CHERRY HILL TOYOTA
TOYOTA LAFONTAINE, EDWARD	y		GALAXY TOYOTA
TOYOTA KINSEY, HOWARD	y		MARION TOYOTA
TOYOTA PETERS, MARTIN	y		NEWARK TOYOTAWORLD-SCION
LEXUS HAPHEEZ, ABDOOL	y		LEXUS OF ORLANDO
TOYOTA ARNTSON, JUSTIN	y		MAGIC TOYOTA
TOYOTA GRIFFITH, BRUCE	y		TOYOTA OF ESCONDIDO
TOYOTA RIVERIA, MICHAEL	y		TOYOTA OF VINELAND
TOYOTA WILDER, LYNN	y		ALEXANDER TOYOTA
TOYOTA GARIBAY, CARLOS	y		J ELWAY MANHATTAN BCH TOY
TOYOTA KITNER, DONALD	y		KENNY ROSS TOYOTA
TOYOTA LEE, ELVIS	y		CITY TOYOTA
TOYOTA MAKI, TRACY	y		HOOAN TOYOTA OF LONG BCH
LEXUS TURNER, CALEB	y		JM LEXUS
TOYOTA WHITE, MIKE	y		BELLEVUE TOYOTA-SCION
LEXUS FUJIMOTO, STEVEN	y		COLISEUM LEXUS OF OAKLAND

QAElectrical	169980 NORMAL
QAElectrical	437388 NORMAL
QAElectrical	465688 NORMAL
QAElectrical	86041 NORMAL
QAElectrical	224944 NORMAL
QAElectrical	111751 NORMAL
QAElectrical	360075 NORMAL
QAElectrical	260772 NORMAL
QAElectrical	116974 NORMAL
QAElectrical	48993 NORMAL
QAElectrical	63871 NORMAL
QAElectrical	31860 NORMAL
QAElectrical	333234 NORMAL
QAElectrical	456939 NORMAL
QAElectrical	213318 NORMAL
QAHybrid	204841 NORMAL
QAHybrid	239615 NORMAL
QAHybrid	95751 NORMAL
QAHybrid	380393 NORMAL
QAHybrid	39861 NORMAL
QAPowertrain	176989 NORMAL
QAPowertrain	65754 NORMAL
QAPowertrain	78764 NORMAL

QAPowertrain	TA090610107	5TBBV54188S	██████	2-Mar-09	3/2/2009 8:55	2-Mar-09	3/2/2009 8:55	15,125
QAPowertrain	TA090610114	JTHBK262775	██████	2-Mar-09	3/2/2009 9:01	2-Mar-09	3/2/2009 9:01	34,697
QAPowertrain	TA090610146	5TFBV54118X	██████	2-Mar-09	3/2/2009 9:53	2-Mar-09	3/2/2009 9:53	3,720
QAPowertrain	TA090610152	JTHCE96S570	██████	2-Mar-09	3/2/2009 10:01	2-Mar-09	3/2/2009 10:01	48,990
QAPowertrain	TA090610156	JTLKE50E881	██████	2-Mar-09	3/2/2009 10:10	2-Mar-09	3/2/2009 10:10	11,814
QAPowertrain	TA090610216	JTMBD32V786	██████	2-Mar-09	3/2/2009 11:33	2-Mar-09	3/2/2009 11:33	4,689
QAPowertrain	TA090610247	JTLKE50E181	██████	2-Mar-09	3/2/2009 12:06	2-Mar-09	3/2/2009 12:06	5,856
QAPowertrain	TA090610282	5TETX62N99Z	██████	2-Mar-09	3/2/2009 13:04	2-Mar-09	3/2/2009 13:04	5,418
QAPowertrain	TA090620036	4T1BK46K97U	██████	3-Mar-09	3/3/2009 6:33	3-Mar-09	3/3/2009 6:33	50,221
QAPowertrain	TA090620061	5TBDT441X5S	██████	3-Mar-09	3/3/2009 7:08	3-Mar-09	3/3/2009 7:08	36,178
QAPowertrain	TA090620157	4T1BK46K67U	██████	3-Mar-09	3/3/2009 9:57	3-Mar-09	3/3/2009 9:57	17,028
QAPowertrain	TA090620175	5TFKV52177X	██████	3-Mar-09	3/3/2009 10:25	3-Mar-09	3/3/2009 10:25	81,594
QAPowertrain	TA090620223	JTEBU17R970	██████	3-Mar-09	3/3/2009 11:39	3-Mar-09	3/3/2009 11:39	27,102
QAPowertrain	TA090620281	5TFBV58168X	██████	3-Mar-09	3/3/2009 13:09	3-Mar-09	3/3/2009 13:09	2,980
QAPowertrain	TA090620353	4T1BK36B25U	██████	3-Mar-09	3/3/2009 15:48	3-Mar-09	3/3/2009 15:48	100
QAPowertrain	TA090620359	JTHBK262972	██████	3-Mar-09	3/3/2009 16:02	3-Mar-09	3/3/2009 16:02	67,758
QAPowertrain	TA090630125	JTHBL46F075	██████	4-Mar-09	3/4/2009 8:52	4-Mar-09	3/4/2009 8:52	45,000
QAPowertrain	TA090630184	4T1BK46K19U	██████	4-Mar-09	3/4/2009 10:00	4-Mar-09	3/4/2009 10:00	3,301
QAPowertrain	TA090630283	4T1BK46K27U	██████	4-Mar-09	3/4/2009 12:27	4-Mar-09	3/4/2009 12:27	32,796
QAPowertrain	TA090630294	4T1BK46K17U	██████	4-Mar-09	3/4/2009 12:40	4-Mar-09	3/4/2009 12:40	89,712
QAPowertrain	TA090630315	5TFBV54117X	██████	4-Mar-09	3/4/2009 13:09	4-Mar-09	3/4/2009 13:09	25,668
QAPowertrain	TA090630331	3TMMU52N19M	██████	4-Mar-09	3/4/2009 13:44	4-Mar-09	3/4/2009 13:44	2,394
QAPowertrain	TA090630377	3TMKU72N27M	██████	4-Mar-09	3/4/2009 15:10	4-Mar-09	3/4/2009 15:10	25,611
QAPowertrain	TA090640033	JTHBN96S165	██████	5-Mar-09	3/5/2009 6:27	5-Mar-09	3/5/2009 6:27	120,343
QAPowertrain	TA090640070	JTHBK262465	██████	5-Mar-09	3/5/2009 7:46	5-Mar-09	3/5/2009 7:46	28,283

Item ID	Model	Year	MPN	City	State	Count	Status	Location	Availability
P0751,P2714	Tundra	2008	44013	BOS	BOS	5	D		3/2/2009 0:00
	IS250	2007	60408	WES	WES	1	INITIATE		3/1/2009 0:00
P0016,P0017,P0018,P0019	Tundra	2008	46090	PTL	PTL	1	INITIATE		3/2/2009 0:00
	GS350	2007	63106	EAS	EAS	1	INITIATE		3/2/2009 0:00
	xB	2008	24063	KCY	KCY	2	INITIATE		3/2/2009 0:00
P0353	RAV4	2008	37173	CAT	CAT	11	INITIATE		3/2/2009 0:00
	xB	2008	34094	CIN	CIN	D	INITIATE		3/2/2009 0:00
P2714	Tacoma	2009	4226	SFR	SFR	1	D		1/21/2009 0:00
	Camry	2007	19020	CAT	CAT	2	INITIATE		3/3/2009 0:00
	Tundra	2005	47029	CAT	CAT	7	INITIATE		3/3/2009 0:00
	Camry	2007	15010	KCY	KCY	4	INITIATE		3/3/2009 0:00
P2443,P2447	Tundra	2007	16005	CIN	CIN	I	D		3/3/2009 0:00
	4Runner	2007	41029	CIN	CIN	L	INITIATE		3/3/2009 0:00
P0012	Tundra	2008	31166	NYR	NYR	2	INITIATE		3/3/2009 0:00
	Avalon	2005	4109	LOS	LOS	5	INITIATE		3/3/2009 0:00
P0300,P2017	IS250	2007	60408	WES	WES	1	INITIATE		3/3/2009 0:00
	LS460	2007	63132	EAS	EAS	3	D		3/4/2009 0:00
P0712	Camry	2009	19021	CAT	CAT	2	INITIATE		3/4/2009 0:00
	Camry	2007	4335	LOS	LOS	8	INITIATE		3/4/2009 0:00
	Camry	2007	34067	CIN	CIN	D	D		3/4/2009 0:00
P0751,P0761,P2714	Tundra	2007	46089	PTL	PTL	1	D	3/4/2009 0:00	
	Tacoma	2009	40011	KCY	KCY	8	INITIATE	3/4/2009 0:00	
	Tacoma	2007	4038	LOS	LOS	3	D	3/4/2009 0:00	
	GS430	2006	64201	SOU	SOU	2	INITIATE	3/5/2009 0:00	
	IS250	2006	60448	WES	WES	3	D	3/5/2009 0:00	

Drivetrain	Automatic Transmission/Transaxle	Fluid	MIL/Warning Light ON
Engine/Hybrid System	Engine Mechanical	Unknown	Misses
Engine/Hybrid System	Engine Control	Driveability	Runs Rough
Engine/Hybrid System	Engine Mechanical	Unknown	Unspecified
Engine/Hybrid System	Engine Control	Driveability	MIL/Warning Light ON
Drivetrain	Automatic Transmission/Transaxle	Shift Function	Abnormal Operation
Engine/Hybrid System	Engine Control	Ignition System	Condition-Not-Listed
Drivetrain	Manual Transmission/Transaxle	Unknown	Abnormal Operation
Engine/Hybrid System	Lubrication	Oil	Leak
Drivetrain	Automatic Transmission/Transaxle	Fluid	MIL/Warning Light ON
Drivetrain	Automatic Transmission/Transaxle	Shift Function	Engagement/slippage
Engine/Hybrid System	Engine Control	ECU	Abnormal Operation
Drivetrain	Automatic Transmission/Transaxle	Unknown	Condition-Not-Listed
Engine/Hybrid System	Engine Control	ECU	MIL/Warning Light ON
Engine/Hybrid System	Engine Control	Driveability	Unspecified
Engine/Hybrid System	Engine Mechanical	Unknown	Unspecified
Engine/Hybrid System	Engine Mechanical	Unknown	Starting-No start
Engine/Hybrid System	Engine Control	Driveability	Unspecified
Drivetrain	Automatic Transmission/Transaxle	Fluid	MIL/Warning Light ON
Engine/Hybrid System	Lubrication	Oil	Leak
Drivetrain	Drive Shaft/Propeller Shaft	Unknown	Noise-wind noise/whistle
Engine/Hybrid System	Engine Control	Driveability	Surge
Engine/Hybrid System	Engine Control	Driveability	Noise-Abnormal
Drivetrain	Automatic Transmission/Transaxle	Unknown	Unspecified
Engine/Hybrid System	Engine Control	Driveability	Runs Rough

codes current and pending when came in. fluid check discolored(deep red almost brown) level seemed good. no slipping. out on vin for bullitent-sb-0078-08. cleared codes. have all gears on road test under normal shifting and forced shifting. codes did not come back.

guest states engine sputters at stop. no codes present.

just replaced short block

intermittent misfire cylinder #1

shifts into park but still rolls away

s-sb-0050-08 engine harness replacement has been performed. tech #923 mike

customers gps unit's speedometer is 2 to 3 mph faster then the veh. we put a 30 tooth gear in and then it went to 4 to 5 mph faster. so we put back the old gear there are no other gears to try....

vvti line leaking

transn shifting improper. water and metal particles in fluid, code p2714 shift sol. d performance stuck on or off. advise on repair or replacement.

transmission free wheels or slips between shifts intermittently,mostly 1-2. does happen in other gears

mil/vsc lights on.bank 2 pulsation pressure does not change,switched pump electrical connection and pump hoses,no change,suspect acv or sensor

customer states when stopped on hill and let off brake to accelerate vehicle rolls backwards a little and try to accell., skid control activates

ck eng light on code p0012 active test bank 1 intake vvt ocv and controller working ok at this time

c/s was driving on highway when vehicle stalled out. he went at gas station thinking he rane out of gas. put some gas and kept crancking to start the engine. then car was towed in lexus of queens where was inspected by diagnostic specialist and find out that valve spring broke,bent the intake valve of cyl# 4 then broke valve in fiew peaces,destroyed head and block

oil leak

line for vvt blown out car ran out of oil. tons of metal in oil drained from engine. vvt actuator attached to front exhaust cam fell apart it is rubbing hole in head and valve cover

cust state when travelling at fwy speed a clunking is heard and felt. seem to coming from the rear or underneath the drives seat. happen most on shiftin between 4th to 6th gear.

engine surge when braking customer states would not idle down or downshift from second gear at stop sign causing vehicle to not stop properly.

customer states after driving 2 hours a/c on and going up hill hears a rattling noise.third time in.test drove with cosomer last visit and could not duplicate.costomer states using good type gas and 89 or 91 grade.advised costomer last visit of normal condition.

dtc p0751 had a note attached to it tell me to create a tas case and contact technical...

when coming to a stop engine will tend to sputter/ shake and almost die. no dtcs present or pending, but can feel vehicle shaking abnormally on cold startup and driving when off throttle.

TOYOTA
LEXUS
TOYOTA
LEXUS
TOYOTA
TOYOTA
TOYOTA

TOYOTA
TOYOTA
TOYOTA
TOYOTA

TOYOTA
TOYOTA
TOYOTA
TOYOTA
LEXUS

LEXUS
TOYOTA
TOYOTA

TOYOTA

TOYOTA
TOYOTA

TOYOTA
LEXUS

LEXUS

y
y
y
y
y
y
y

y
y
y
y

y
y
y
y
y

y
y
y

y

y
y

y
y

y

HANDY TOYOTA
LEXUS OF RIVERSIDE
MAGIC TOYOTA
BURDICK LEXUS
JERRY ACKERMAN TOYOTA
SUPERIOR TOYOTA
SUNNYSIDE TOYOTA

STEVENS CREEK TOYOTA
RUSSEL TOYOTA
DAN CAVA'S TOYOTA WORLD
LEWIS TOYOTA

GREEN'S TOY. OF LEXINGTON
PHIL BACHMAN TOYOTA
ATLANTIC TOYOTA
TOYOTA OF GLENDORA
LEXUS OF RIVERSIDE

LEXUS OF QUEENS
BILL KIDD'S TIMONIUM TOYO
SIERRA TOYOTA

NASSIEF FORD-MERC. TOYOTA

TOYOTA OF KIRKLAND
BILLION TOYOTA

HAMER TOYOTA
WESTSIDE LEXUS

LEXUS OF STEVENS CREEK

QAPowertrain	92130 NORMAL
QAPowertrain	17622 NORMAL
QAPowertrain	328205 NORMAL
QAPowertrain	41261 NORMAL
QAPowertrain	246521 NORMAL
QAPowertrain	224541 NORMAL
QAPowertrain	343630 NORMAL
QAPowertrain	677151 NORMAL
QAPowertrain	497725 NORMAL
QAPowertrain	84339 NORMAL
QAPowertrain	226237 NORMAL
QAPowertrain	706402 NORMAL
QAPowertrain	6005695 NORMAL
QAPowertrain	611716 NORMAL
QAPowertrain	1 NORMAL
QAPowertrain	17507 NORMAL
QAPowertrain	36964 NORMAL
QAPowertrain	6969 NORMAL
QAPowertrain	691163 NORMAL
QAPowertrain	19588 NORMAL
QAPowertrain	305895 NORMAL
QAPowertrain	382817 NORMAL
QAPowertrain	39328 NORMAL
QAPowertrain	775687 NORMAL
QAPowertrain	22637 NORMAL

QAPowertrain	TA090640131	2T3BF33V29W	[REDACTED]	5-Mar-09	3/5/2009 8:52	5-Mar-09	3/5/2009 8:52	3
QAPowertrain	TA090640134	JTLKE50EX81	[REDACTED]	5-Mar-09	3/5/2009 8:59	5-Mar-09	3/5/2009 8:59	34,051
QAPowertrain	TA090640157	JTHBK262X65	[REDACTED]	5-Mar-09	3/5/2009 9:30	5-Mar-09	3/5/2009 9:30	60,272
QAPowertrain	TA090640165	4T1BK46K39U	[REDACTED]	5-Mar-09	3/5/2009 9:38	5-Mar-09	3/5/2009 9:38	17,383
QAPowertrain	TA090640208	JTHBK262065	[REDACTED]	5-Mar-09	3/5/2009 11:15	5-Mar-09	3/5/2009 11:15	31,648
QAPowertrain	TA090640308	1NXBR30EX6Z	[REDACTED]	5-Mar-09	3/5/2009 14:50	5-Mar-09	3/5/2009 14:50	34,692
QAPowertrain	TA090640340	JTEDD21A760	[REDACTED]	5-Mar-09	3/5/2009 17:15	5-Mar-09	3/5/2009 17:15	27,403
QAPowertrain	TA090640341	JTKKT624765	[REDACTED]	5-Mar-09	3/5/2009 18:53	5-Mar-09	3/5/2009 18:53	35,965
QAPowertrain	TA090650001	JTHBH96S665	[REDACTED]	6-Mar-09	3/6/2009 3:34	6-Mar-09	3/6/2009 3:34	25,129
QAPowertrain	TA090650022	JTHCH96S260	[REDACTED]	6-Mar-09	3/6/2009 5:53	6-Mar-09	3/6/2009 5:53	61,598
QAPowertrain	TA090650055	4T1CA38P75U	[REDACTED]	6-Mar-09	3/6/2009 6:54	6-Mar-09	3/6/2009 6:54	37,230
QAPowertrain	TA090650072	4T3BK11A69U	[REDACTED]	6-Mar-09	3/6/2009 7:20	6-Mar-09	3/6/2009 7:20	270
QAPowertrain	TA090650287	5TDBY67A78S	[REDACTED]	6-Mar-09	3/6/2009 13:47	6-Mar-09	3/6/2009 13:47	18,663
QAPowertrain	TA090650334	1NXBR32EX5Z	[REDACTED]	6-Mar-09	3/6/2009 17:02	6-Mar-09	3/6/2009 17:02	43,505
QAPowertrain	TA090650335	5TFRV54157X	[REDACTED]	6-Mar-09	3/6/2009 17:35	6-Mar-09	3/6/2009 17:35	9,954
QAPowertrain	TA090660002	5TFDV58109X	[REDACTED]	7-Mar-09	3/7/2009 6:18	7-Mar-09	3/7/2009 6:18	246
QAPowertrain	TA090660007	4T1BE46KX9U	[REDACTED]	7-Mar-09	3/7/2009 8:51	7-Mar-09	3/7/2009 8:51	11,618
QAPowertrain	TA090660024	5TETU62N06Z	[REDACTED]	7-Mar-09	3/7/2009 11:37	7-Mar-09	3/7/2009 11:37	47,741
QAPowertrain	TA090660038	4T4BE46K69R	[REDACTED]	7-Mar-09	3/7/2009 15:43	7-Mar-09	3/7/2009 15:43	7,228
QAPowertrain	TA090660040	JTMZD33V475	[REDACTED]	7-Mar-09	3/7/2009 16:20	7-Mar-09	3/7/2009 16:20	11,759
QAPowertrain	TA090660041	JTDBR32E070	[REDACTED]	7-Mar-09	3/7/2009 16:44	7-Mar-09	3/7/2009 16:44	62,383

Model	Year	MPN	Region	Region	Code	Quantity	Order Type	Order Date
P0171	2009	21061	CIN	CIN	B	D	INITIATE	2/25/2009 0:00
	2008	21061	CIN	CIN	B	INITIATE	2/27/2009 0:00	
	2006	60405	WES	WES	1	INITIATE	3/4/2009 0:00	
P0430	2009	34036	CIN	CIN	D	INITIATE	3/5/2009 0:00	
P0300	2006	60431	WES	WES	3	INITIATE	3/5/2009 0:00	
	2006	43020	DEN	DEN	4	INITIATE	3/4/2009 0:00	
P0705	2006	4508	LOS	LOS	2	INITIATE	3/5/2009 0:00	
	2006	4842	LOS	LOS	2	INITIATE	3/5/2009 0:00	
P0751	2006	61031	SOU	SOU	6	INITIATE	3/6/2009 0:00	
P0171,P0174 P0746,P0776,P2714,P2808	2006	63802	EAS	EAS	2	D	INITIATE	3/6/2009 0:00
	2005	38026	BOS	BOS	3	INITIATE	3/6/2009 0:00	
	2009	41070	CIN	CIN	J	INITIATE	3/6/2009 0:00	
	2008	14044	KCY	KCY	7	INITIATE	3/5/2009 0:00	
P0500,P0741,P0756 P0308	2005	4104	SFR	SFR	1	D	INITIATE	3/6/2009 0:00
	2007	4263	LOS	LOS	4	INITIATE	3/6/2009 0:00	
P0012	2009	45045	CAT	CAT	10	D	INITIATE	3/7/2009 0:00
	2009	7009	CAT	CAT	1	D	INITIATE	3/7/2009 0:00
P043E,P043F,P2401,P2402,P2419 P0500	2006	4018	LOS	LOS	5	INITIATE	3/7/2009 0:00	
	2009	4080	LOS	LOS	1	INITIATE	3/7/2009 0:00	
P043E,P043F,P2401,P2402,P2419 P0123,P2135	2007	4421	SFR	SFR	3	D	INITIATE	3/7/2009 0:00
	2007	4180	LOS	LOS	9	INITIATE	3/7/2009 0:00	

Engine/Hybrid System	Engine Control	Driveability	Starting-No start
Engine/Hybrid System	Engine Control	Driveability	Missing/Wrong
Engine/Hybrid System	Engine Mechanical	Unknown	Misses
Engine/Hybrid System	Engine Control	ECU	MIL/Warning Light ON
Engine/Hybrid System	Engine Mechanical	Unknown	MIL/Warning Light ON
Drivetrain	Manual Transmission/Transaxle	Fluid	Leak
Drivetrain	Automatic Transmission/Transaxle	Fluid	Leak
Drivetrain	Automatic Transmission/Transaxle	Unknown	MIL/Warning Light ON
Drivetrain	Automatic Transmission/Transaxle	Shift Function	Hesitation/Stumble
Engine/Hybrid System	Engine Mechanical	Unknown	Stalls/Quits
Engine/Hybrid System	Engine Control	Unknown	Unspecified
Drivetrain	Automatic Transmission/Transaxle	Unknown	Abnormal Operation
Drivetrain	Transfer/4wd/Awd	Unknown	Noise-wind noise/whistle
Drivetrain	Automatic Transmission/Transaxle	Shift Function	Engagement/slippage
Engine/Hybrid System	Engine Control	Ignition System	Abnormal Operation
Engine/Hybrid System	Emission Control	Unknown	MIL/Warning Light ON
Engine/Hybrid System	Engine Control	Driveability	Vibration
Engine/Hybrid System	Emission Control	Charcoal Canister	Abnormal Operation
Engine/Hybrid System	Engine Control	Driveability	MIL/Warning Light ON
Engine/Hybrid System	Emission Control	Charcoal Canister	Abnormal Operation
Engine/Hybrid System	Engine Control	Driveability	Stalls/Quits

no codes below 20 deg. car will not start cranks no start with scan tool connected can see all sensors and commands checking coils no spark check pwr and grd. good no signal from ecm
car had unsmooth idle looking at data car was pumping up volume for vacuum leak, found leak in intake #4
misfire during cold operation temperature
mil on b2s2 does not indicate a bad converter at 3k rpm
mil light on, multiple cylinder misfire. verified at cold start in am
transaxle leaking from input shaft seal. first repair attempt. waiting on sop part. ordered 03/05/2009
transmission fluid is leaking from casing.
check engine light on p0705
customer states in low gear can feel hesitation in shift pattern at random.
vehicle starts and runs with foot on gas, will stall and be very hard to start. found oil to be gray in color with a lot of metal flake. removed valve covers and cams found signs of oil starvation. cam journals are scored roller rockers are flat spotted and timing chain guides are worn through dspm is aware of this vehicle and already approved for short block and head replacement.

cust. states will stop pulling while driving at 60mph after decell on a slight grade. shift shock between gears, no reverse after 2-3 hours setting.
loud clicking noise when in 4 wd, goes away completely if it put back into 2 wd
customer states vehicle will not move in drive, found fluid slightly burnt, checked fluid level ok, slips in drive and in reverse, took pressure readings idle--60psi idle reverse--75 psi stall d--75 psi stall reverse--90 psi
misfire only come on with hard acc,
customer came in with check engine light on had code p0012 checked tsb didn't see anything on it cleared light and let customer drive may be bad sensor
customer states rough idle checked idle compared idle too 2 09 camrys 3 different managers tried car with me i made print of idle speed all normal i let customer set in all cars she agreed it the same feels should not have any vibration.

mil on. as per tis diag for code p2419, tested can vent vsv, op ok, volt 12.4 v. tested evap purge vsv op ok, 12.4v. manually ran vac pump, op ok.
checked evap lines, vent lines, all connected, no visual damage. ran on board evap check, failed, same codes. no tsb for this vehicle.
vehicle int. stalls and check engine light illuminates

TOYOTA
TOYOTA
LEXUS
TOYOTA
LEXUS
TOYOTA
TOYOTA
TOYOTA
LEXUS

LEXUS
TOYOTA
TOYOTA
TOYOTA

TOYOTA
TOYOTA

TOYOTA

TOYOTA
TOYOTA
TOYOTA

TOYOTA
TOYOTA

y
y
y
y
y
y
y
y
y

y
y
y
y

y
y

y

y
y
y

y
y

LA FONTAINE TOYOTA
LA FONTAINE TOYOTA
LEXUS OF WESTMINSTER
METRO TOYOTA
FREEMAN LEXUS
MARK MILLER TOYOTA
J ELWAY MANHATTAN BCH TOY
MILLER TOYOTA
NALLEY LEXUS - ROSWELL

INSKIP LEXUS
BALISE TOYOTA OF WARWICK
CHUCK HUTTON TOYOTA, LLC
TOYOTA OF DES MOINES

TOYOTA SUNNYVALE
VALLEY-HI TOYOTA

DANVILLE TOYOTA

NEWARK TOYOTAWORLD-SCION
CLAREMONT TOYOTA
PENSKE TOYOTA

ROSEVILLE TOYOTA
TOYOTA OF EL CAJON - TCSC

QAPowertrain 134156 NORMAL
QAPowertrain 134406 NORMAL
QAPowertrain 405852 NORMAL
QAPowertrain 704749 NORMAL
QAPowertrain 747116 NORMAL
QAPowertrain 4196078 NORMAL
QAPowertrain 240010 NORMAL
QAPowertrain 996702 NORMAL
QAPowertrain 209800 NORMAL

QAPowertrain 471235 NORMAL
QAPowertrain 105922 NORMAL
QAPowertrain 198239 NORMAL
QAPowertrain 628164 NORMAL

QAPowertrain 184675 NORMAL
QAPowertrain 514631 NORMAL

QAPowertrain 128357 NORMAL

QAPowertrain 63923 NORMAL
QAPowertrain 600968 NORMAL
QAPowertrain 452280 NORMAL

QAPowertrain 12391 NORMAL
QAPowertrain 208554 NORMAL